

Map & Photo Legend



SECI-13-02 Looking northeast at the cove in Outer Rocky Bay.

	Exclusion Booming
	Calm-water Boom
	Helicopter Landing Zone




SECI-13-02 Looking east at the cove in Outer Rocky Bay.

Geographic Response Strategies for Southeast Cook Inlet Subarea

Outer Rocky Bay, SECI-13

Center of map at 59° 14.2' N Lat., 151° 22.3' W Lon.

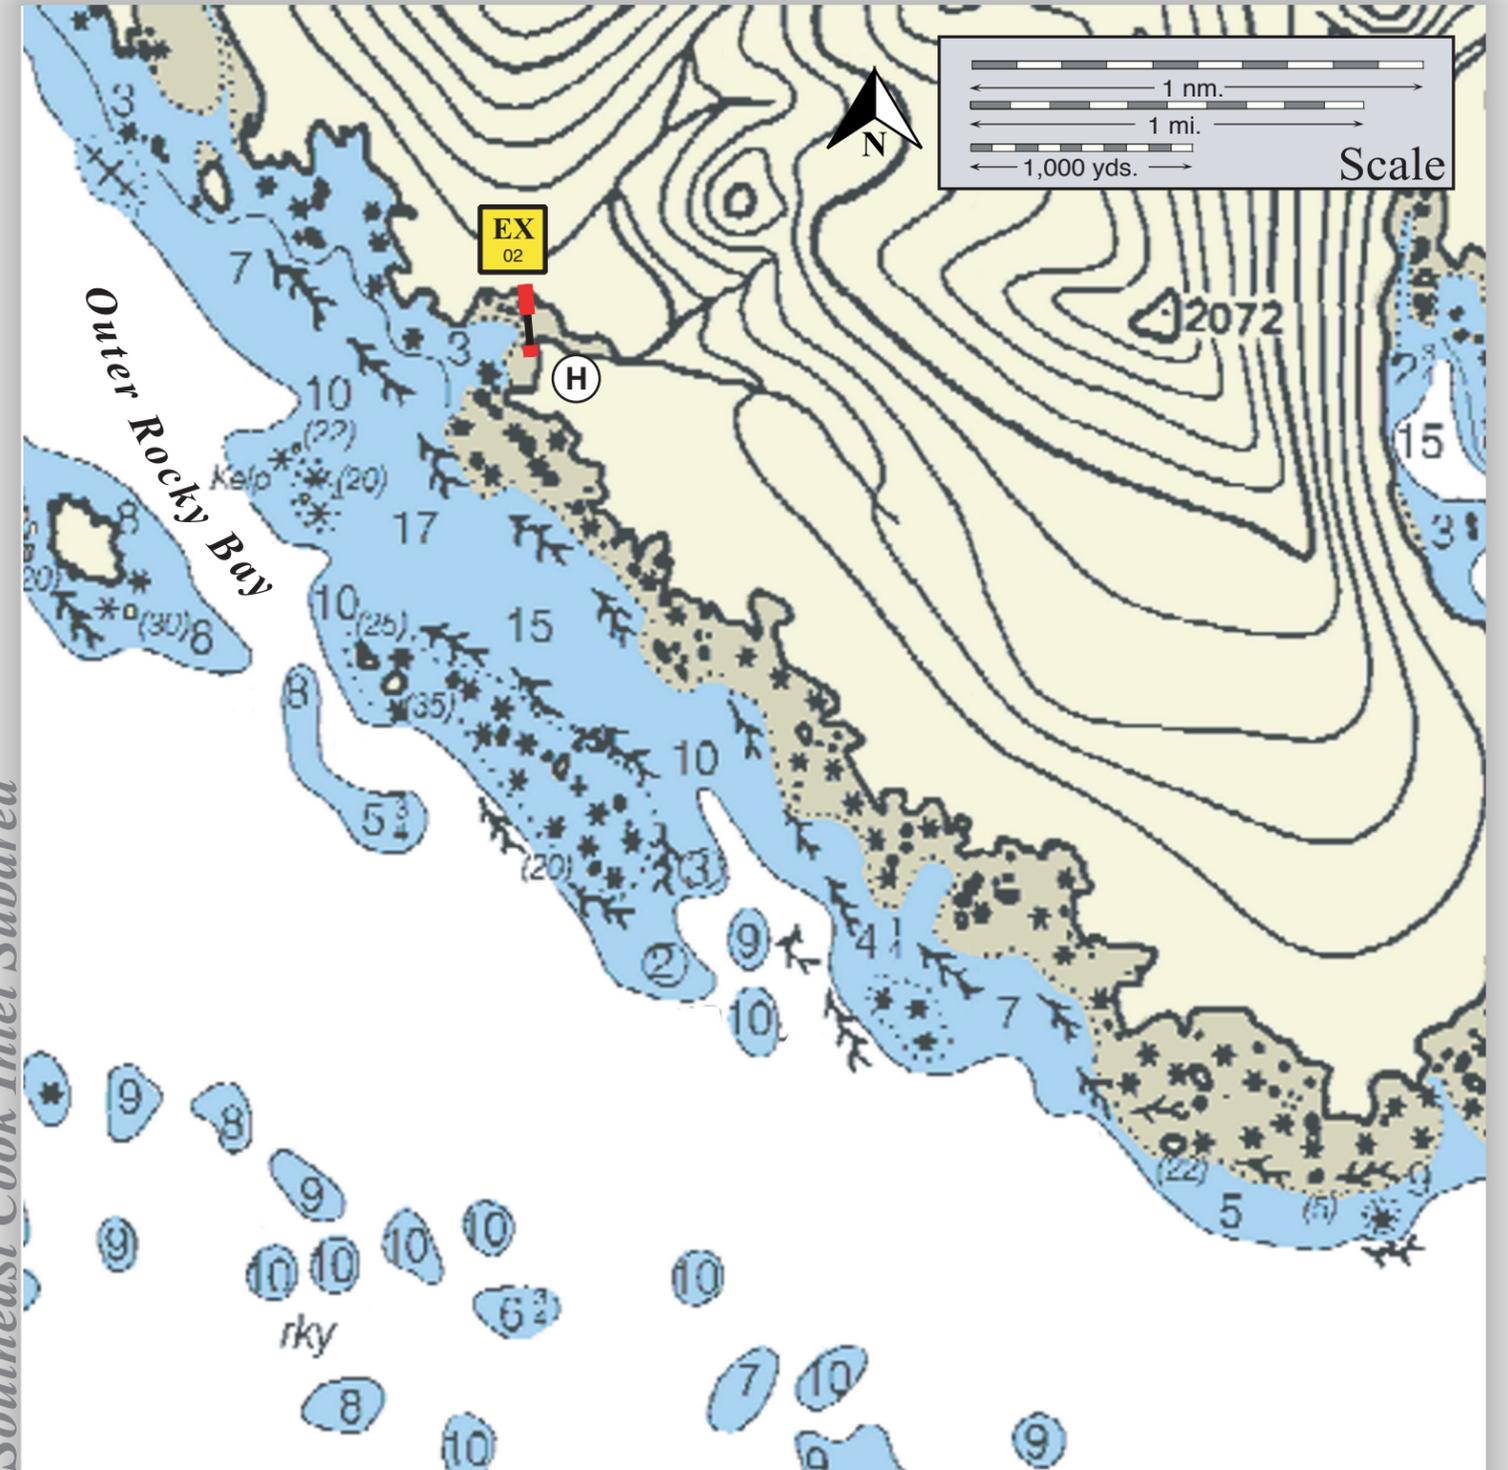

This is not intended for navigational use.

Soundings in fathoms

ID	Location and Description	Response Strategy	Implementation	Response Resources	Staging Area	Site Access	Resources Protected (months)	Special Considerations
SECI-13-02 	Outer Rocky Bay Cove Anchor Points: a. Lat. 59° 14.39N Lon. 151° 21.95W b. Lat. 59° 14.33N Lon. 151° 21.90W	Exclusion Exclude oil from impacting the identified stream and intertidal area in Outer Rocky Bay Cove.	Transport equipment to site by helicopter. Deploy anchors and boom with inflatable skiffs (class 6). Place calm-water boom at identified locations to exclude oil from impacting the intertidal areas and stream. Tend daily at high tide.	Deployment Equipment 600 ft. calm-water boom 6 ea. small anchor systems 4 ea. anchor stakes Vessels 1 ea. class 6, inflatable Personnel/Shift 3 ea. vessel crew Tending Vessels 1 ea. class 3/4 1 ea. class 6 Personnel/Shift 3 ea. vessel crew	Vessel platform	Via marine waters Chart 16645-1	Fish- intertidal spawning- herring (April-May) Birds-seabird nesting Marine mammals- seals, otters Habitat- marsh, sheltered rocky shoreline	Vessel master should have local knowledge. Use extreme caution, shoal waters with numerous reefs and rocks. Consider using a bear guard. FOSC Historic Properties Specialist should MONITOR operations. Title 41 permitting required from ADNR. Site surveyed: 6/08/04 SECI GRS Tactics Committee. Tested: not yet