Table 1-Depth To Groundwater And Groundwater Elevations

Well ID	Date	Total Depth	Depth to Water	Height of Water Column	Elevation of Datum	Ground-water elevation
MW01-01	10/14/99	19.27	14.57	4.70	967.78	953.21
MW01-02	10/14/99	20.15	14.95	5.20	967.46	952.51
MW04-01	10/14/99	16.85	12.73	4.12	962.68	949.95
MW06-01	7/28/99	18.59	16.06	2.53	947.55	931.49
MW08-01(B)	7/28/99	14.06	5.86	8.20	1006.36	1000.50
MW08-02	7/28/99	13.64	8.07	5.57	1006.70	998.63
MW08-03	7/28/99	10.73	8.30	2.43	1006.29	997.99

Note: All Dimensions are feet, datum for all wells is the top of PVC casing.

Results of Laboratory Analyses

Location	Sample ID	DRO (mg/L)	RRO (mg/L)	AS(µg/L)	Cd (µg/L)	Cr(µg/L)	Pb(µg/L)
ADEC Cleanup Standard		1.5	1.1	50	5	100	15
DWW-01	W101499Drinking	0.300U	NA	NA	NA	NA	NA
MW01-01	W101499MW01-01	0.300U	NA	NA	NA	NA	NA
MW01-02	W101499MW01-02	0.300U	NA	NA	NA	NA	NA
MW04-01	W101499MW04-01	0.300U	NA	NA	NA	NA	NA
MW06-01	GCTS-99-0601-W	0.297U	0.495U	0.0337	0.0042	0.0863	0.0303
MW06-01 Duplicate	GCTS-99-0602-W	0.300U	0.500U	0.0247	0.00348	0.0582	0.0236
MW08-01B	GCTS-99-0801(B)-W	0.306U	0.510U	0.0616	0.0014	0.171	0.0749
MW08-02	GCTS-99-0802-W	0.300U	0.500U	0.0176	0.000911	0.0683	0.0238
MW08-03	GCTS98-0803-W	0.297U	0.495U	0.239	0.00303	0.2	0.0699
MW-TB	Trip Blank	0.0454U	0.500U	NA	NA	NA	NA

Notes: NA - not analyzed.
U - analyte undetected above associated detection limit.
ADEC Cleanup Standard - Alaska groundwater cleanup levels from Table C in 18AAC75, dated October 1, 1999.

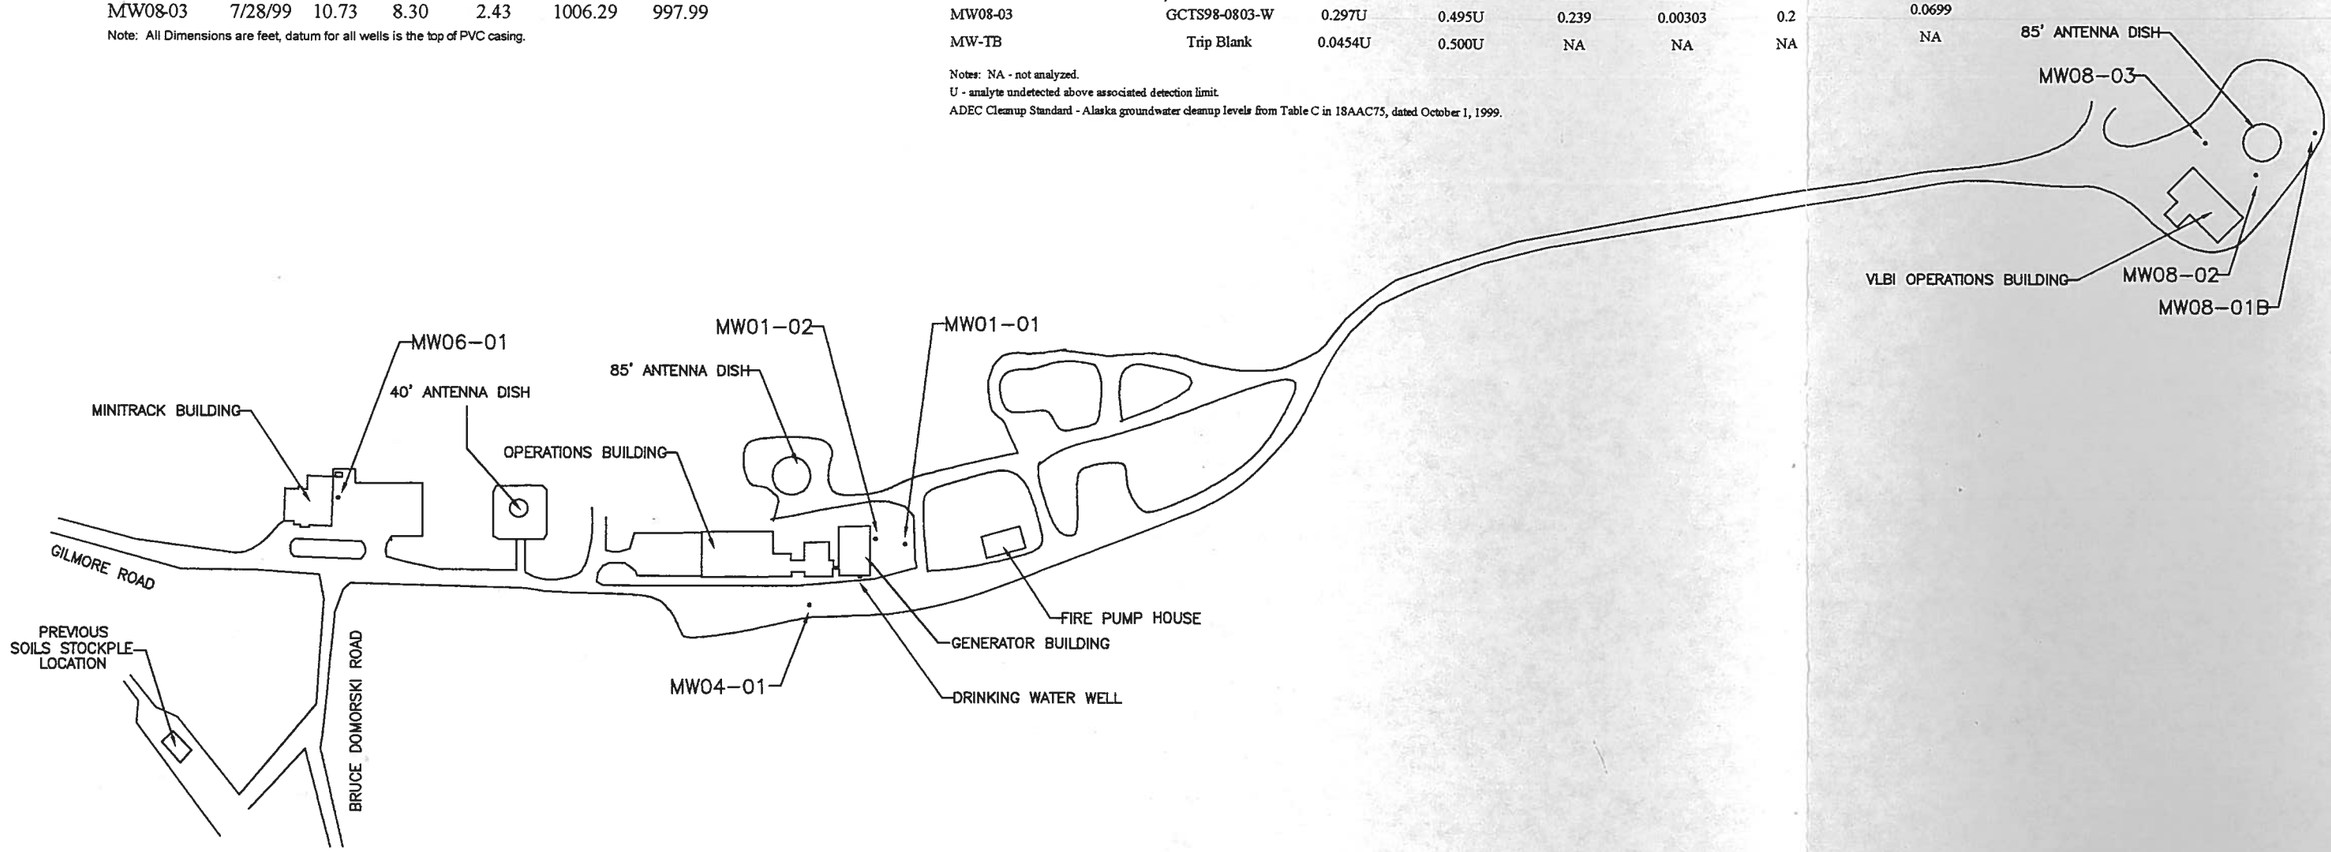

NORTECH

ENVIRONMENTAL & ENGINEERING CONSULTANTS
2400 College Road, Fairbanks, Alaska 99709
(907) 452-5688 FAX: (907) 452-5694

NOAA GILMORE CREEKTRACKING STATION
FAIRBANKS ALASKA
MONITOR WELL LOCATION

DATE: 11-9-99	SCALE: NTS
PROJ MGR: CRM	PROJECT: 98106.1
DRAWN: DRB	DWG. NO.: FIG 2

FIGURE 2